

ASBESTOS INSPECTION REPORT of:

Building # BA146

MCB CAMP LEJEUNE



Print Date

Thursday, August 18, 2011

INSPECTION SUMMARY

BLDG #: BA146

YEAR BUILT: 1962

OCCUPANT: OFFICERS RENTAL COTTAGE
Contact Mayor Sam O'Leary

ASBESTOS MANAGER: Billy Parkin 451-5837

BUILDING COMMENTS:

HAZ RANK 3/GREEN [AH AUG09]
ACM JOINT COMPOUND AND FLOOR TILE THROUGHOUT, USE CAUTION.

AUG09
PVS. ACM REMAINS, ADDL SAMPLING, NO NEW FINDINGS, RECOMMEND TEM CONFIRMATIONS TO BE DONE

OCT06:
ACM REMAINS, ADDITIONAL ACM INCLUDES:
JOINT MATERIAL
12" WHITE FLOOR TILE MASTIC
12" GRAY FLOOR TILE/MASTIC
12" BEIGE FLOOR TILE/MASTIC

NOTIFICATION OF ACM IN BUILDING

NOTICE: The following asbestos-containing materials have been identified in this structure. Refer to survey findings for additional information or contact the Asbestos Program Manager. Please note ACM that is intact and undisturbed is not considered a significant health hazard to building occupants.

Friable ACM(s) identified

DESCRIPTION	LOCATION	Date	Quantity
No friable ACM records found in database			

Non-friable ACM(s) identified

DESCRIPTION	LOCATION	Date	Quantity
12" GREEN FLOOR TILE AND ADHESIVE	BATHROOM CLOSET	1/27/2005	9 SF
DRYWALL AND JOINT MATERIAL	WALLS AND CEILINGS THROUGHOUT	10/5/2006	1,232 SF
12" WHITE FLOOR TILE AND ADHESIVE	THROUGHOUT (OVER HM13)	10/5/2006	1,242 SF
12" GRAY FLOOR TILE AND ADHESIVE	THROUGHOUT, UNDER HM12 TILE	10/5/2006	1,242 SF
12" BEIGE FLOOR TILE AND ADHESIVE	SOUTHWEST BEDROOM CLOSET, UNDER HM12	10/5/2006	9 SF
12" GREEN FLOOR TILE AND ADHESIVE	BATHROOM CLOSET	10/5/2006	9 SF
12" WHITE FLOOR TILE AND ADHESIVE	THROUGHOUT (OVER HM13)	8/31/2009	1,242 SF
12" GRAY FLOOR TILE AND ADHESIVE	THROUGHOUT, UNDER HM12 TILE		1,242 SF
12" BEIGE FLOOR TILE AND ADHESIVE	SOUTHWEST BEDROOM CLOSET, UNDER HM12	8/31/2009	9 SF
12" GREEN FLOOR TILE AND ADHESIVE	BATHROOM CLOSET	8/31/2009	9 SF

Tested Non ACM or REMOVED Materials

<i>DESCRIPTION</i>	<i>LOCATION</i>	<i>Date</i>
CARPET ADHESIVE	BEDROOMS, LIVING ROOM, DINING ROOM	1/27/2005
EXTERIOR CAULKING,	WINDOWS	1/27/2005
DUCT SEALANT, GRAY	EXTERIOR HVAC UNIT	1/27/2005
DUCT SEALANT, GRAY	EXTERIOR HVAC UNIT	1/27/2005
TEXTURED CEILING MATERIAL	1ST FLOOR	10/5/2006
LINOLEUM AND ADHESIVE,	KITCHEN	1/27/2005
INTERIOR CAULKING,	WINDOW	8/31/2009
EXTERIOR CAULKING,	NORTHSIDE CHIMNEY FLASHING	8/31/2009
ELECTRICAL WRAPPED WIRING	ATTIC, ABANDONED LINES	8/31/2009
ASPHALT SHINGLE AND TAR PAPER	ATTIC DEBRIS, BELIVED PREVIOUS ROOFING COMPONENTS	8/31/2009
INTERIOR CAULKING,	ATTIC CHIMNEY ON BRICK	8/31/2009
INTERIOR CAULKING,	ATTIC, DRYWALL CEILING JOINT	8/31/2009
JOINT MATERIAL	SOUTHWEST BEDROOM WALL (DAMAGE)	8/31/2009

- HEALTH ASPECTS:** ACM only presents a health hazard when asbestos fibers are airborne and inhaled. Avoid disturbance which will release fibers. The presence of asbestos does not constitute a health hazard.
- CONDITIONS TO AVOID:** Do not disturb or cause damage to ACM. Do not sand, grind or abrade materials or cause damage with any type of equipment.
- REPORTS OF DAMAGE:** Report any damage, dust or debris that may come from ACM or suspect ACM, or any change in the condition of materials, or accidental disturbance to the Asbestos Program Manager.
- RESPONSE ACTION:** Corrective action initiated to minimize fiber release and protect personnel.
- INSPECTION:** ACM will be inspected periodically to evaluate any changes in condition.
- RECORDKEEPING:** The Camp Lejeune Asbestos Program Manager maintains a copy of the survey for the building.

CAMP LEJEUNE Asbestos Program Manager: William (Billy) Parkin

Phone: (910) 451-5837

SAMPLES COLLECTED

Sample	HA	Description	Sample Date	Sample Location	Chr (%)	Amo (%)	Oth (%)
BA146-01-01	01	LINOLEUM AND ADHESIVE, WHITE SQUARE PATTERN	1/27/2005	KITCHEN	0	0	0
BA146-02-01	02	CARPET ADHESIVE BEIGE/BROWN BERBER CARPET	1/27/2005	DINING ROOM	0	0	0
BA146-02-02	02	CARPET ADHESIVE BEIGE/BROWN BERBER CARPET	1/27/2005	BEDROOM 2 CLOSET	0	0	0
3A146-03-00ri0f	03	12" GREEN FLOOR TILE AND ADHESIVE	10/5/2006	N/A	9	9	9
3A146-03-00ri0f	03	12" GREEN FLOOR TILE AND ADHESIVE	8/31/2009	N/A	9	9	9
BA146-03-01	03	12" GREEN FLOOR TILE AND ADHESIVE	1/27/2005	BATH CLOSET	6	0	0
BA146-04-01	04	EXTERIOR CAULKING, WHITE	1/27/2005	SIDE WINDOW	0	0	0
BA146-05-01	05	DUCT SEALANT, GRAY TYPE I	1/27/2005	HVAC UNIT	0	0	0
BA146-06-01	06	DUCT SEALANT, GRAY TYPE II	1/27/2005	HVAC UNIT	0	0	0
BA146-10-10	10	TEXTURED CEILING MATERIAL	10/5/2006	LEFT ROOM	0	0	0
BA146-10-11	10	TEXTURED CEILING MATERIAL	10/5/2006	BEDROOM #3	0	0	0
BA146-10-12	10	TEXTURED CEILING MATERIAL	10/5/2006	BEDROOM #1	0	0	0
3A146-11-00ri0f	11	DRYWALL AND JOINT MATERIAL	8/31/2009	N/A	9	9	9
BA146-11-10	11	DRYWALL AND JOINT MATERIAL	10/5/2006	CLOSET, BEDROOM #1	2	0	0
BA146-11-11	11	DRYWALL AND JOINT MATERIAL	10/5/2006	HALLWAY CLOSET	3	0	0
BA146-11-12	11	DRYWALL AND JOINT MATERIAL	10/5/2006	KITCHEN	0	0	0
3A146-12-00ri0f	12	12" WHITE FLOOR TILE AND ADHESIVE	8/31/2009	N/A	9	9	9
BA146-12-10	12	12" WHITE FLOOR TILE AND ADHESIVE	10/5/2006	LIVING ROOM, NE	5	0	0
BA146-12-11	12	12" WHITE FLOOR TILE AND ADHESIVE	10/5/2006	BEDROOM SE CLOSET	5	0	0

Sample	HA	Description	Sample Date	Sample Location	Chr (%)	Amo (%)	Oth (%)
3A146-13-00ri05	13	12" GRAY FLOOR TILE AND ADHESIVE	8/31/2009	N/A	9	9	9
BA146-13-10	13	12" GRAY FLOOR TILE AND ADHESIVE	10/5/2006	LIVING ROOM, NE	5	0	0
3A146-14-00ri08	14	12" BEIGE FLOOR TILE AND ADHESIVE	8/31/2009	N/A	9	9	9
BA146-14-10	14	12" BEIGE FLOOR TILE AND ADHESIVE	10/5/2006	BEDROOM#2, CLOSET	5	0	0
BA146-20-20	20	ELECTRICAL WRAPPED WIRING	8/31/2009	ATTIC CNTR	0	0	0
BA146-21-20	21	ASPHALT SHINGLE AND TAR PAPER	8/31/2009	ATTIC CNTR	0	0	0
BA146-21-21	21	ASPHALT SHINGLE AND TAR PAPER	8/31/2009	ATTIC EAST CNTR	0	0	0
BA146-22-20	22	INTERIOR CAULKING, WHITE	8/31/2009	ATTIC NORTH CNTR CHIMNEY	0	0	0
BA146-23-20	23	INTERIOR CAULKING, WHITE	8/31/2009	ATTIC, EAST CNTR	0	0	0
BA146-24-20	24	JOINT MATERIAL	8/31/2009	SW BEDROOM, NORTH WALL	0	0	0
BA146-24-21	24	JOINT MATERIAL	8/31/2009	SE BEDROOM, SOUTH WALL	0	0	0
BA146-25-20	25	INTERIOR CAULKING, WHITE	8/31/2009	SE BEDROOM	0	0	0
BA146-26-20	26	EXTERIOR CAULKING, WHITE	8/31/2009	NORTH CHIMNEY	0	0	0

SAMPLE LEGEND


SAMPLE IDENTIFICATION

01-01 (-) POSITIVE (+) OR NEGATIVE (-) FOR THE PRESENCE OF ASBESTOS

TR - TRACE

HOOMOGENOUS AREA

NAK - NOT ACCESSIBLE (AREA)

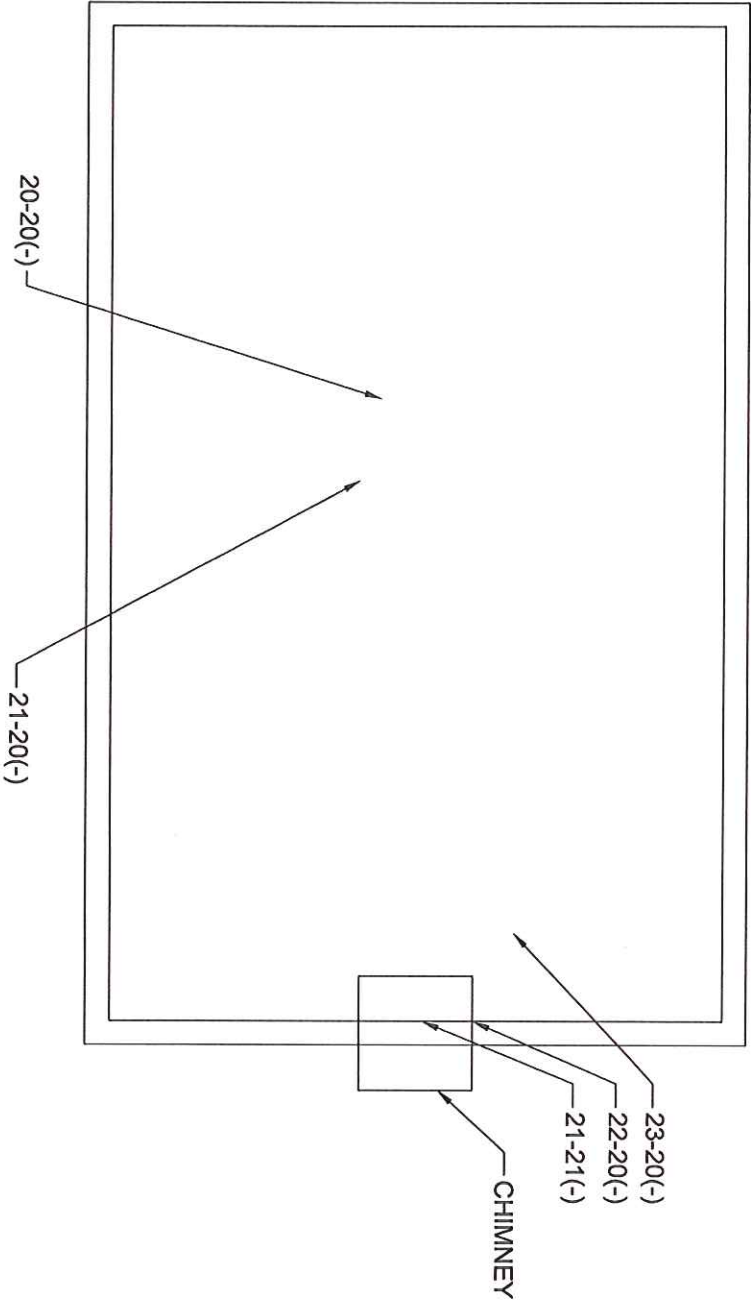

NO ACM IDENTIFIED ON THIS FLOOR



DATE	
TIME	
BY	
FOR	

CY2008 ASBESTOS INSPECTION
BA146-A



MCB CAMP LEJEUNE, NC